

**DAACO, INC.**

Pump and Tank Contractors

5212 West Market Street

Greensboro, N.C. 27409


Phone (919) 294-3199

Guilford County Emergency Services

P.O. Box 18807

Greensboro, N.C. 27419

April 12, 1993

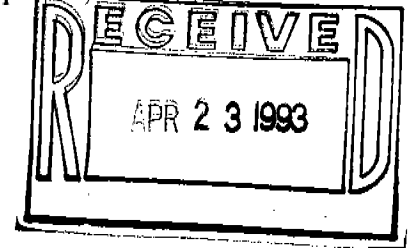

ATTN: Kelly Gage

**RE: Information on Melvin's Service Closure for 4-7-93 Request**

Kelly,

Listed below is the additional information you requested, I've listed the responses in the same order as your questions.


- A     The USGS maps and City maps are enclosed. This site seems to lie on the boundary of two soil classifications. Enon-Urban on the northern half and Mecklenburg-Urban on the southern portion.
- B     The sample depths for the four gasoline tanks were approximately 112", (one foot below bottom of tank). for the initial tests.  
The second sample taken from this excavation was at approximately 142", (after two and a half feet of soil was removed from the contaminated corner).  
The diesel samples were taken at a depth of about 94", which is the tank diameter, (46"), plus the cover soil and one foot below tank bottom, (48").
- C     Soil for laboratory analysis was taken from under both ends of each tank, (less than 20"). Collection of samples were with rubber gloves and new canning jars. These jars were filled and then covered with foil with the cap tighten over the foil. Some of the dry ice used in rendering the tanks enert was saved to preserve the samples until they were refrigerated at the shop.
- D     Decontamination of the collecting tools is accomplished with our steam cleaner. Normally in taking samples from beneath a tank, the back-hoe bucket or a shovel is used, with care taken to retrieve soil that did not come in contact with the tool.
- E     Analysis method used at that time for the original tank samples and retest of the gas excavation was SWA46-3540, followed by Cal. GC FID, (information inclosed).
- F     Composite samples were retrieved as described is section C for the tank samples. The farmed soil was placed in a container furnished by Burlington Research, (400 milliliter w/teflon seal).
- G     The collection location for the primary samples are indicated on the map enclosed.

2.

Thank you for your patients, if there is anything else needed we can provide, please contact us.

Sincerely,

DAACO, INC.

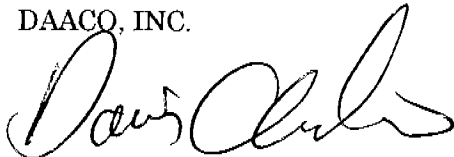A handwritten signature in cursive script, appearing to read "Davis Andrews".

Davis Andrews

FOR  
TANKS  
IN  
NC

Return Completed Form To:  
The appropriate DEM Regional Office according to the county of the facility's location.  
[SEE MAP ON REVERSE SIDE OF OWNERS COPY (PINK) FOR REGIONAL  
OFFICE ADDRESS].

State Use Only  
I.D. Number \_\_\_\_\_  
Date Received \_\_\_\_\_

INSTRUCTIONS

Complete and return within (30) days following completion of site investigation.

I. Ownership of Tank(s)

Owner Name (Corporation, Individual, Public Agency, or Other Entity)  
Thomas Sawyer  
Street Address  
P.O. Box 14683  
County  
Guilford  
City  
Greensboro State  
N.C. Zip Code  
27416  
Area Code  
919 Telephone Number  
373-0808

II. Location of Tank(s)

Facility Name or Company  
Tom Sawyer's Tire & Grocery (formerly  
Melvin's Service)  
Facility ID # (if available)  
\_\_\_\_\_  
Street Address or State Road  
1205 M.L. King Blvd. (formerly Asheboro St.)  
County  
Guilford City  
Greensboro Zip Code  
\_\_\_\_\_  
Area Code  
919 Telephone Number  
373-0808

III. Contact Person

Name  
Tom Sawyer Job Title  
Owner Telephone No. (Area Code)  
919-373-0808  
Closure Contractor  
DARCO, INC. 5212 W. Market St. Greensboro 919-294-3199  
(Name) (Address) Telephone No. (Area Code)  
Lab  
Guilford Laboratory 2006 Church St. Greensboro 919-379-1004  
(Name) (Address) Telephone No. (Area Code)

IV. U.S.T. Information

V. Excavation Condition

VI. Additional Information Required

Tank No.	Size in Gallons	Tank Dimensions	Last Contents	Water in Excavation		Free Product		Notable Color or Visible Soil Contamination	
				Yes	No	Yes	No	Yes	No
1	2,000	64" x 12'	GAS		✓		✓		✓
2	2,000	64" x 12'	GAS		✓		✓		✓
3	3,000	64" x 18'	GAS		✓		✓		✓
4	3,000	64" x 18'	GAS		✓		✓	✓	
5	550	46" x 74"	Diesel		✓		✓		✓

See reverse side of pink copy (owner's copy) for additional information required by N.C. - DEM in the written report and sketch.

VII. Check List

Check the activities completed.

- ☒ Contact local fire marshal
  - ☒ Notify DEM Regional Office before abandonment
  - ☒ Drain & flush piping into tank
  - ☒ Remove all product and residuals from tank
  - ☒ Excavate down to tank
  - ☒ Clean and inspect tank
  - ☒ Remove drop tube, fill pipe, gauge pipe, vapor recovery tank connections, submersible pumps and other tank fixtures.
  - ☒ Cap or plug all lines except the vent and fill lines.
  - ☒ Purge tank of all product & flammable vapors.
  - ☒ Cut one or more large holes in the tanks.
  - ☒ Backfill the area.
- Date Tank(s) Permanently closed: July 13 & July 31  
Date of Change-in-Service: \_\_\_\_\_

**ABANDONMENT IN PLACE**  
☐ Fill tank until material overflows tank opening;  
☐ Plug or cap all openings;  
☐ Disconnect and cap or remove vent line  
☐ Solid inert material used - specify: \_\_\_\_\_

**REMOVAL**  
☒ Create vent hole  
☒ Label tank  
☒ Dispose of tank in approved manner  
Final tank destination: SAFELY TANK  
disposal

VIII. Certification (Read and Sign)

I certify under penalty of law that I have personally examined and am familiar with the information submitted in this and all attached documents, and that based on my inquiry of those individuals immediately responsible for obtaining the information, I believe that the submitted information is true, accurate, and complete.

Print name and official title of owner or owner's authorized representative

Signature

Date Signed

Simmie L Kelley Manager

Simmie L Kelley

4-22-93